

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch
690 Walnut Ave. St. 150
Vallejo, CA 94592-1133
(707) 649-5453
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 69.28**WELDING INSPECTION REPORT****Resident Engineer:** Pursell, Gary**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-001294**Date Inspected:** 15-Jan-2008**Project Name:** SAS Superstructure**OSM Arrival Time:** 1930**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 730**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai, China**CWI Name:** Ye Yongjun**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** Caltrans Mock-Up**Summary of Items Observed:**




Caltrans Quality Assurance (QA) Inspector, Ken Jobes, arrived on site at the Zhenhua Port Machinery Company (ZPMC) facility at Changxing Island, in Shanghai, China, to randomly monitor welding and Quality Control (QC) functions. While on site, the QA Inspector observed and/or discovered the following:

The Caltrans Inspector observed the completed Weld No. MUB-MA21 H/J-14 on the 89M Tower Mock-Up. It was observed that ZPMC CWI, Ye Yongjun (AWS CWI No. 07031461) had apparently visually accepted this weld. The QA Inspector observed that this weld is visually unacceptable in accordance with AWS D1.5-2002, paragraph 3.6 and Figure 3.3 due to insufficient throat and incomplete fusion between weld beads. See attached pictures.

These observations do not appear to meet the requirements of the job specifications.

WELDING INSPECTION REPORT

(Continued Page 2 of 3)

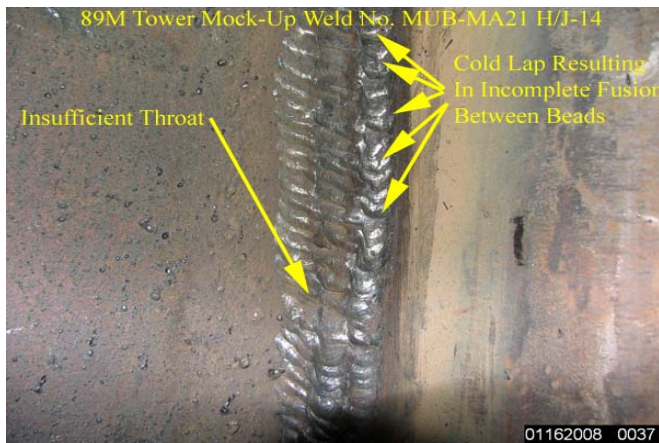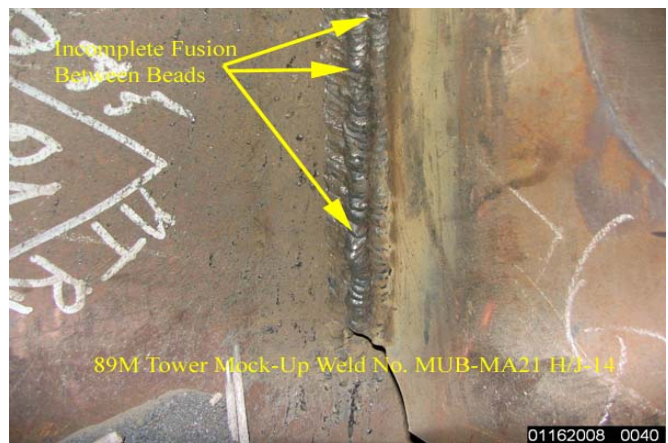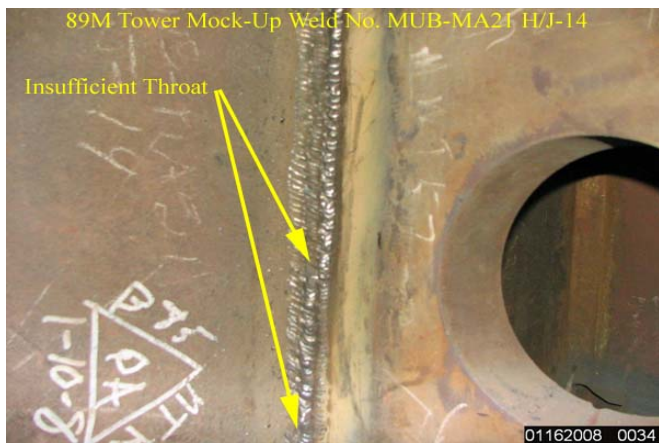

Summary of Conversations:

As identified within the contents of this report.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Mazen Wahbeh, (818) 292-0659, who represents the Office of Structural Materials for your project.

WELDING INSPECTION REPORT

(Continued Page 3 of 3)

Inspected By: Jobes,Kenneth

Quality Assurance Inspector

Reviewed By: Cochran,Jim

QA Reviewer